



**Electro Optical Components, Inc.**


5464 Skylane Boulevard, Suite D, Santa Rosa, CA 95403

Toll Free: 855-EOC-6300

[www.eoc-inc.com](http://www.eoc-inc.com) | [info@eoc-inc.com](mailto:info@eoc-inc.com)



# Effects of sterilization on silver halide fiber optic probes

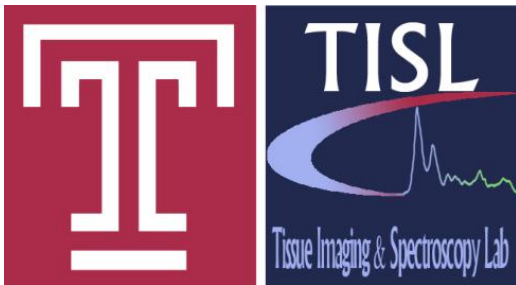


# Method


- Fifteen silver halide probe tips were divided equally into the Sterrad<sup>®</sup>, autoclave and control groups.
- Sterilized the Sterrad<sup>®</sup> group three times using Sterrad<sup>®</sup>
  - Hydrogen peroxide gas plasma with an exposure time of 55 minutes
- Sterilized the autoclave group three times using the autoclave
  - Steam sterilization at 270°F for a 4 minute exposure cycle.
- Kept the control group unsterilized
- Collected spectra and images using a Leica dissecting microscope before and after each cycle of sterilization. The samples used to collect spectra were 95% Ethanol, ATR Standard, bovine cartilage and bovine patellar tendon.

# **Sterrad® Results**


**Silver halide probe tip 1 from Sterrad® group before sterilization**

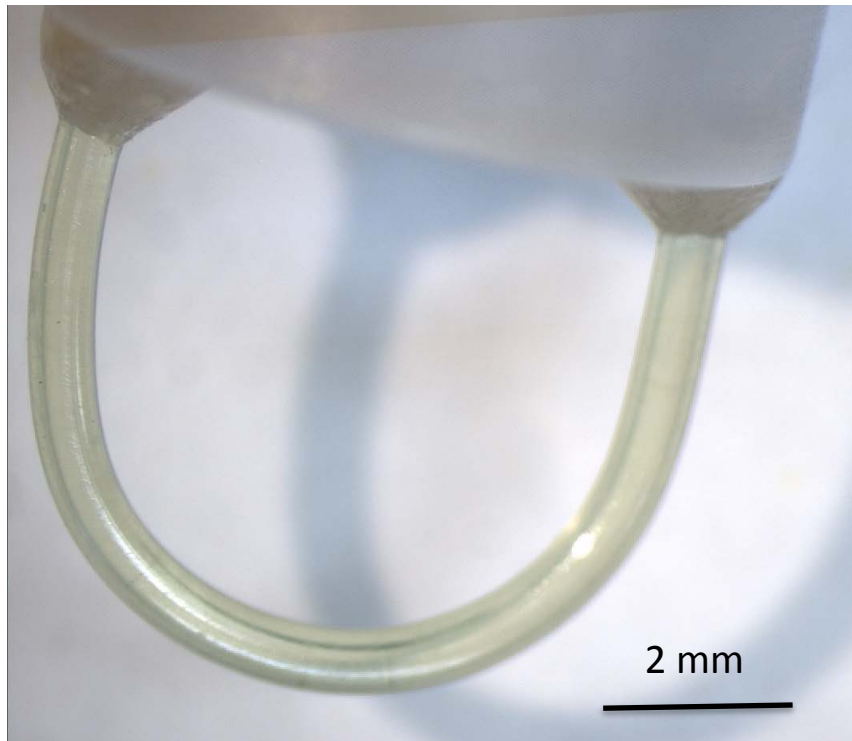


**Silver halide probe tip 1 from Sterrad® group after sterilization cycle 1**

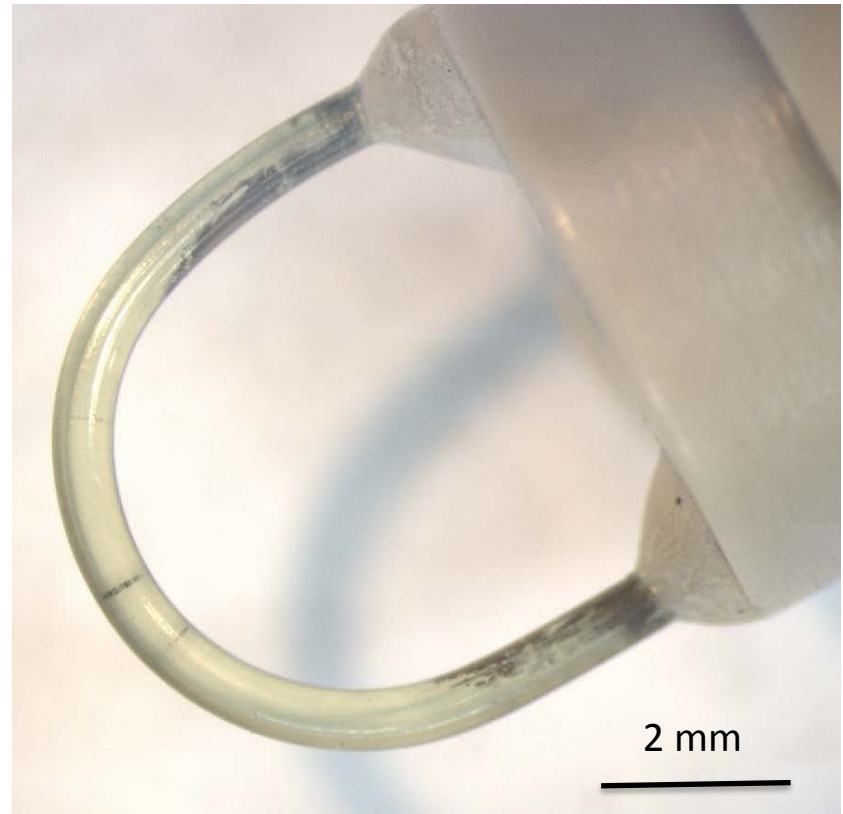

**Silver halide probe tip 1 from Sterrad® group before sterilization**

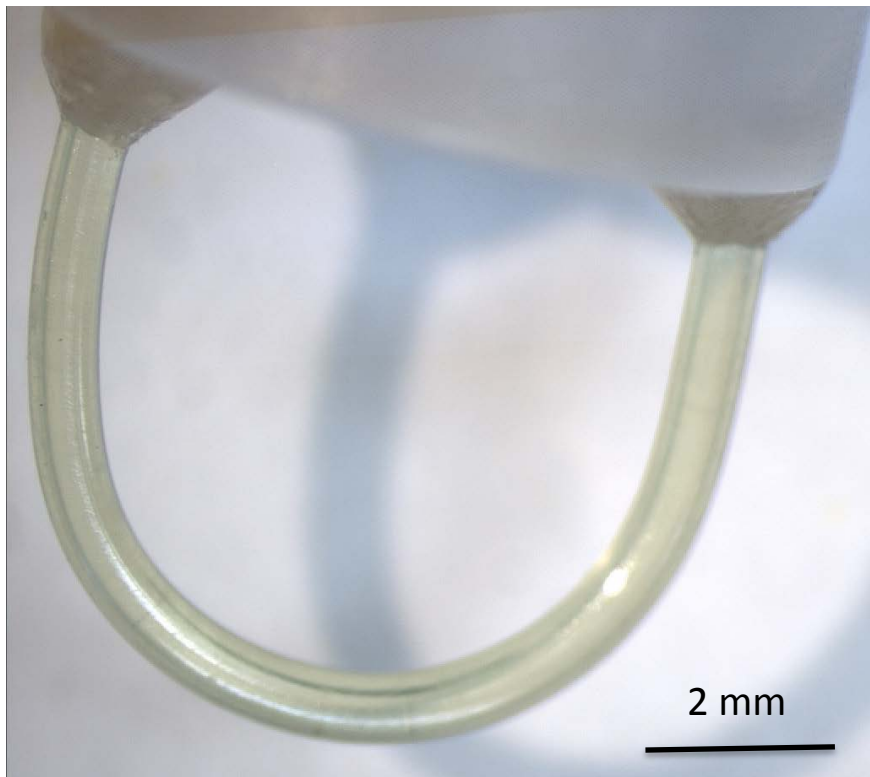

**Silver halide probe tip 1 from Sterrad® group after sterilization cycle 3**

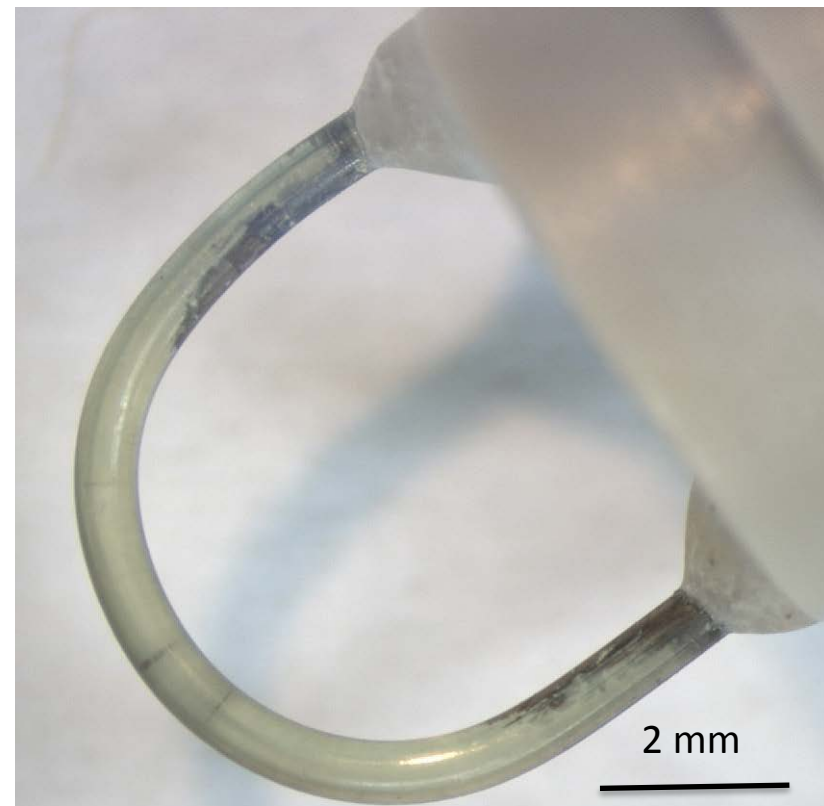


## Summary of results for Sterrad<sup>®</sup> group


- A probe tip in the Sterrad<sup>®</sup> group became blackened at the two ends after sterilization cycle 1.
- The blackened effect was not observed in the remainder of the probes in the Sterrad<sup>®</sup> group.
- The epoxy resin, securing the fiber optic to the polymer mount, changed from a tan to a white color for all probes in the Sterrad<sup>®</sup> group.

# **Autoclave Results**

**Silver halide probe tip 1 from autoclave group before sterilization**

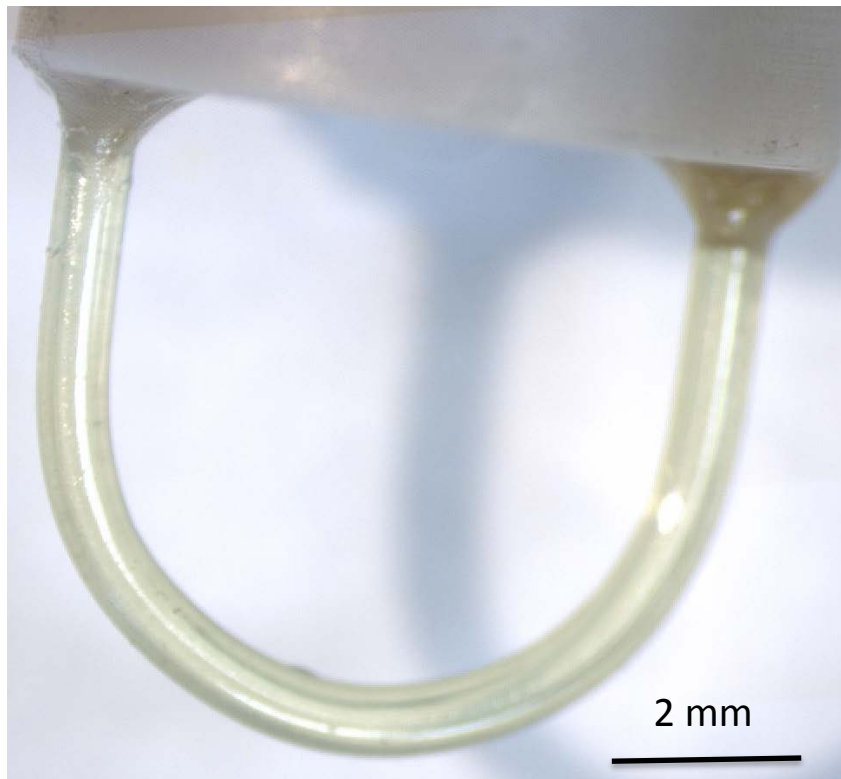


**Silver halide probe tip 1 from autoclave group after sterilization cycle 1**

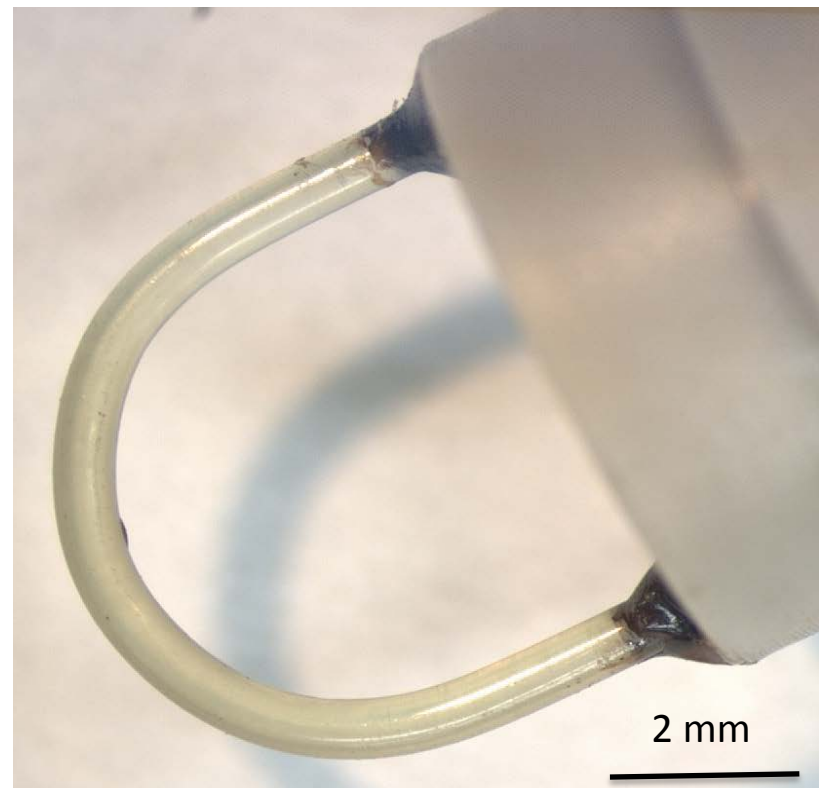




**Silver halide probe tip 1 from autoclave group before sterilization**

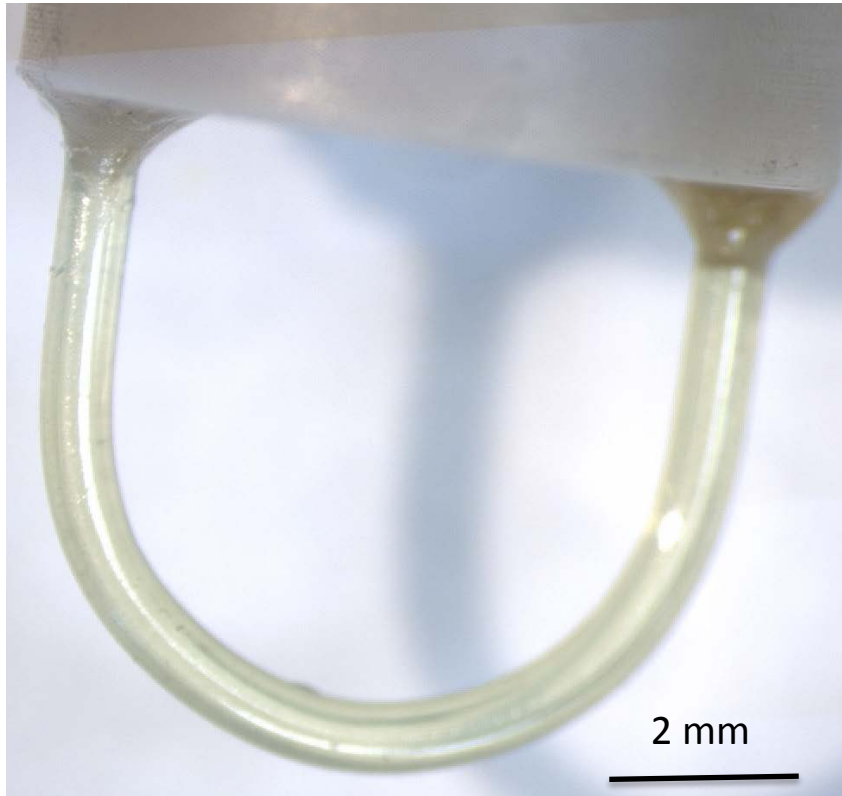

**Silver halide probe tip 1 from autoclave group after sterilization cycle 3**

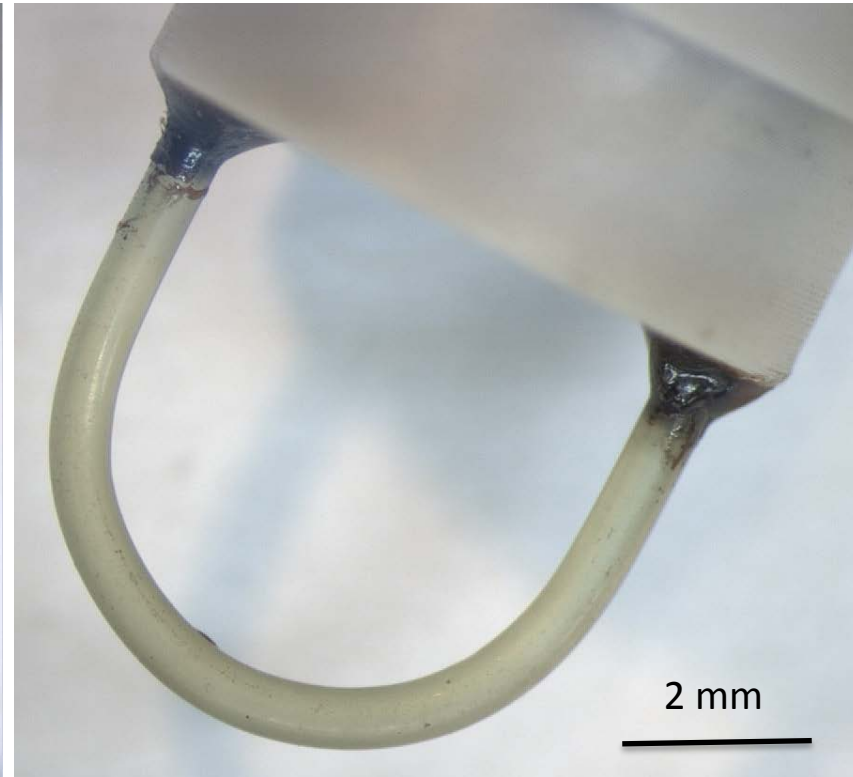


## Summary of results for the autoclave group

In the autoclave group all probes appeared cloudy after the first cycle of sterilization and the epoxy resin changed to a dark brown color.


.

# Control Group Results

Silver halide probe tip 1 from control group before sterilization

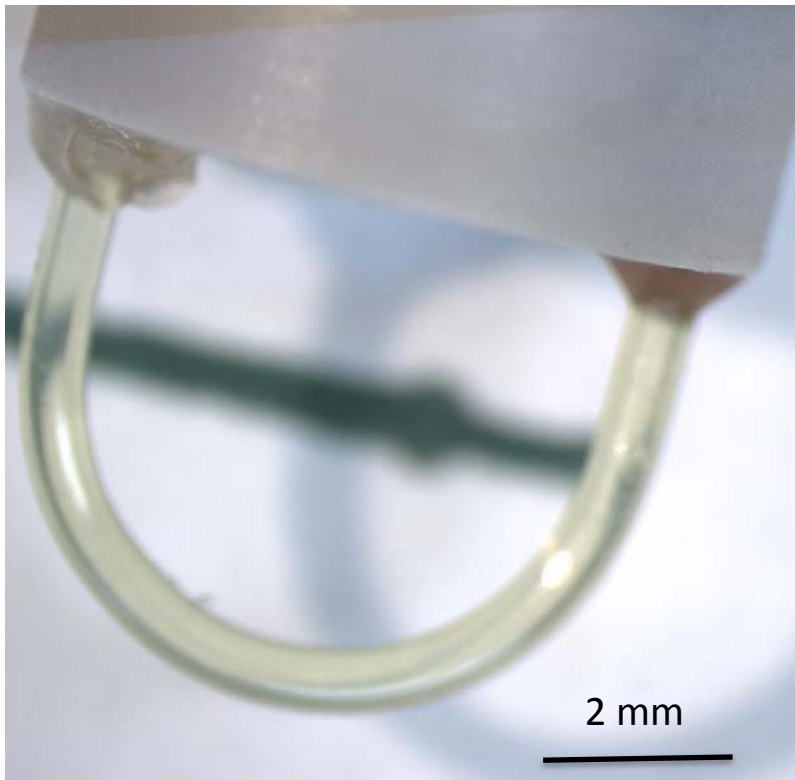


Silver halide probe tip 1 from control group after sterilization cycle 3

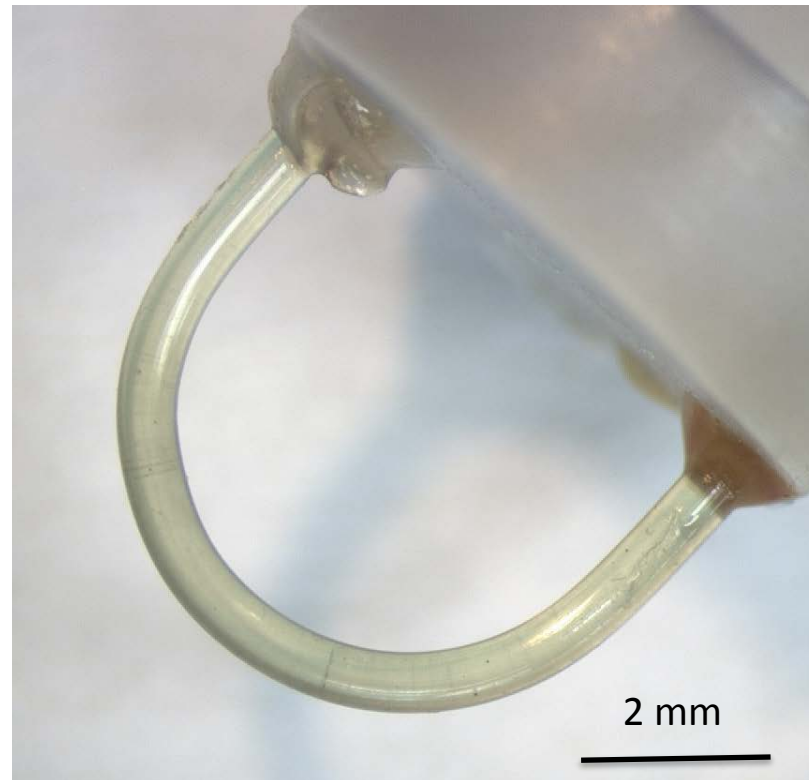


**There were no changes observed in the control group's probe tips for all sterilization cycles.**

## Spectral overlay of bovine cartilage after sterilization cycle 1

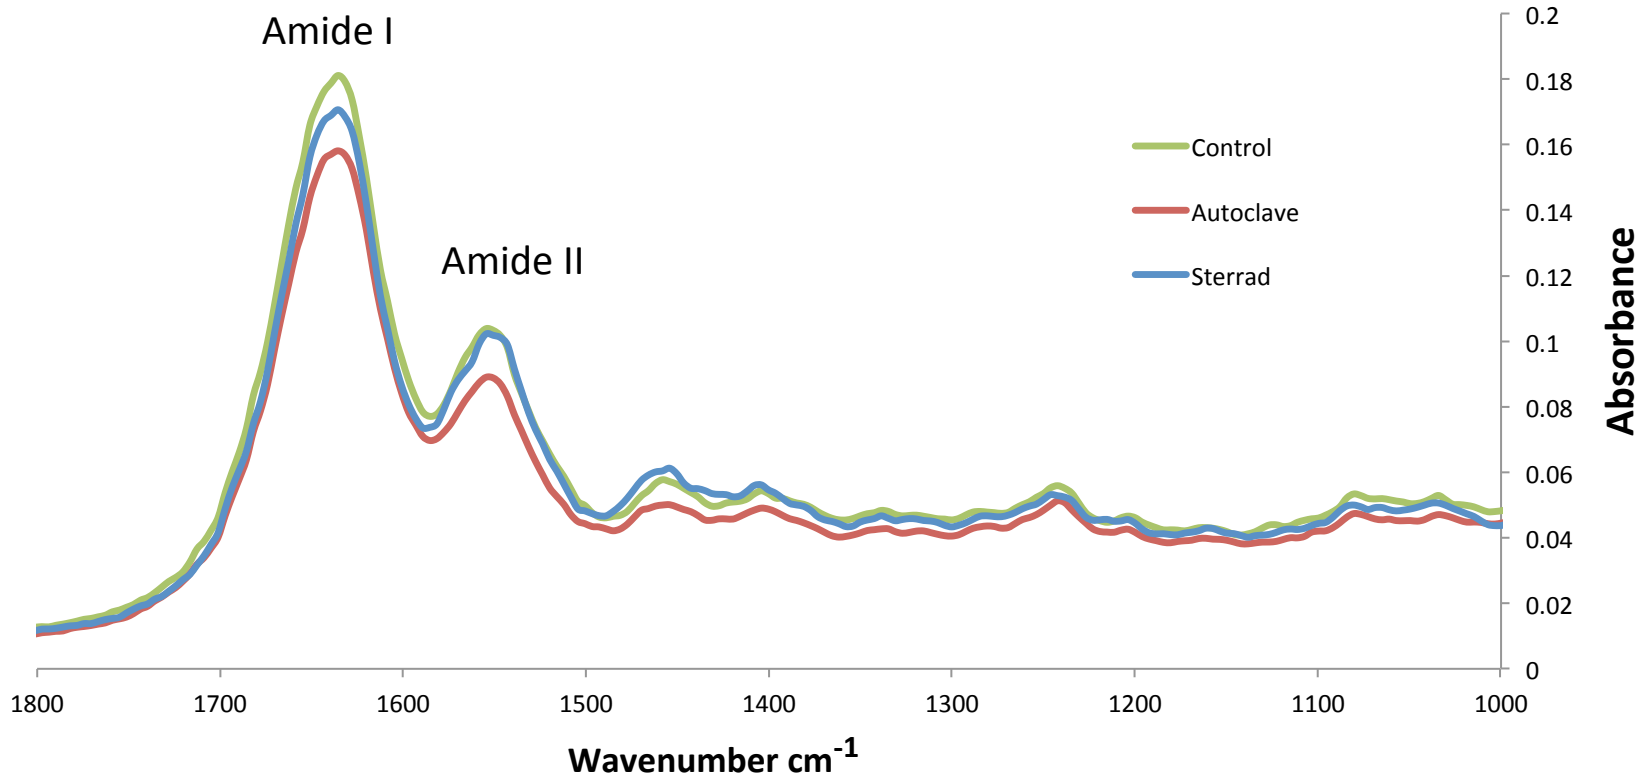

The spectral overlay above of the Sterrad, autoclave and control group does not show any significant changes in the Amide I and II peak heights in bovine cartilage.

## Average Peak Height Ratio for Amide II/Amide I of Cartilage

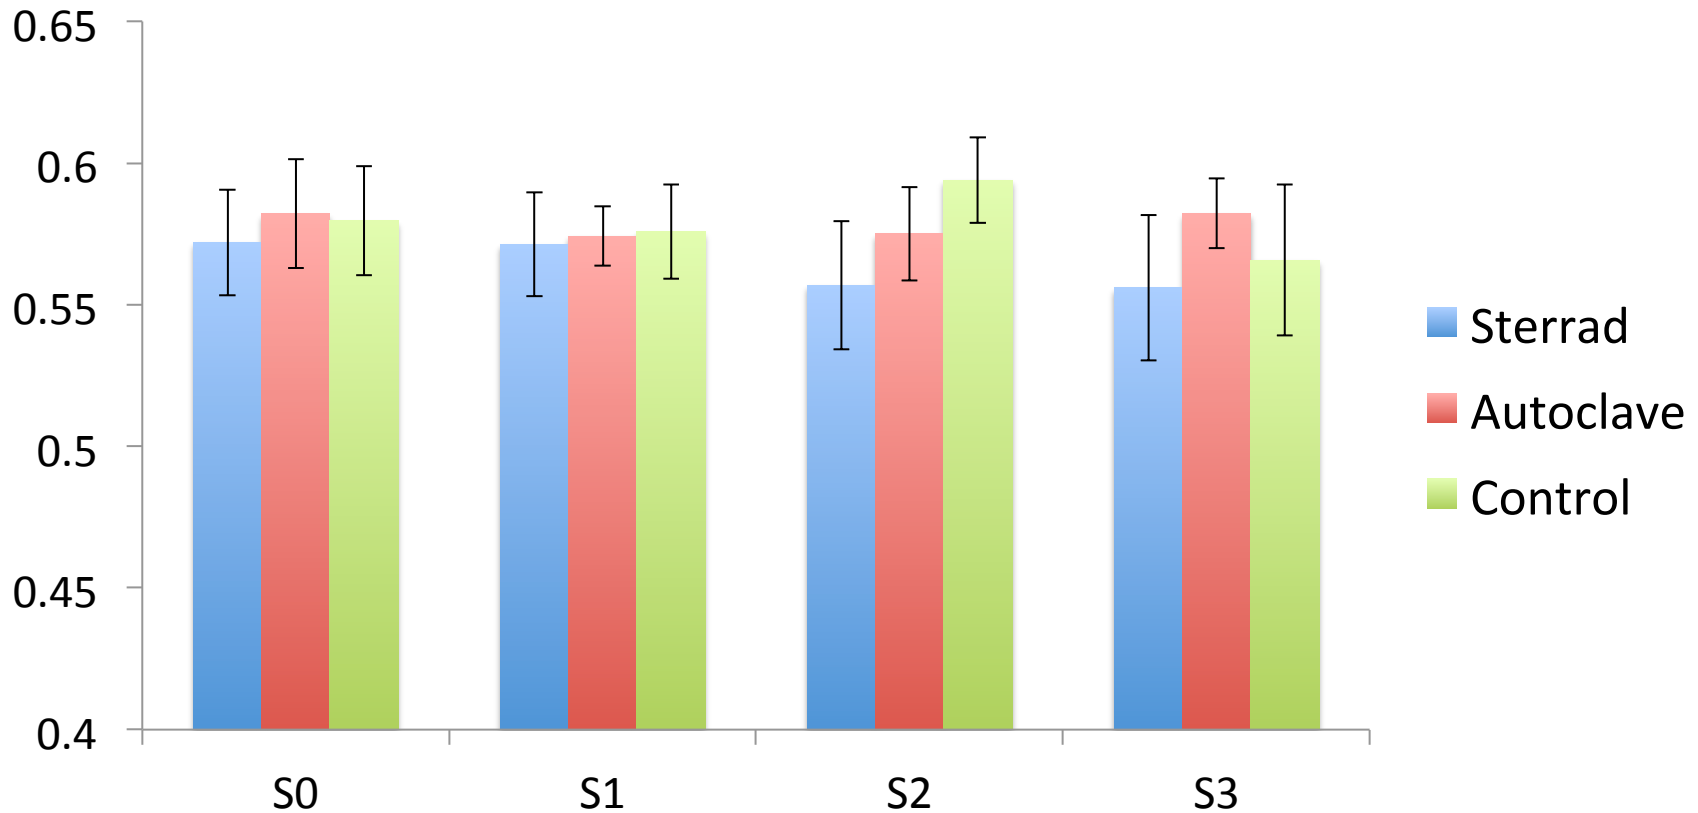

There were no significant changes in the peak height ratio of the bovine cartilage sample after each cycle of sterilization. This trend was seen in the 95% ethanol, ATR standard and patellar tendon sample (data not shown). The data suggests that Sterrad and autoclave did not have a significant effect on the optical properties of probe tips.

# Conclusion

- Despite the visually changes in the tips after sterilization cycle one, there were no significant changes in the optical properties of the probe tips in the Sterrad<sup>®</sup> and autoclave group.
- We conclude that the Sterrad will be the better choice to sterilize the silver halide probe tips since only one probe tip out of five had a change in appearance after sterilization, while all the tips in the autoclave group appeared cloudy.